
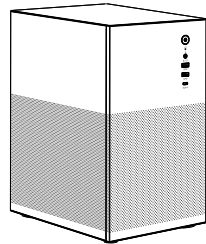


LCPOWER™

www.lc-power.com

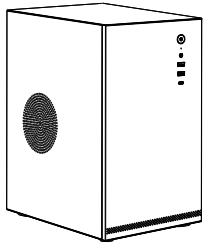


6100MB/6100MW 6101MB User manual

Silent Power Electronics GmbH
Formerweg 8, 47877 Willich, Germany
www.lc-power.com | info@lc-power.com


1 Uninstalling the side panels

Remove the four screws (a).
Then slide the side panels backward to remove them from the case.

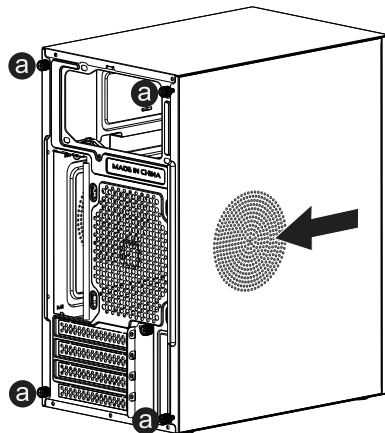


2 Motherboard Installation (supports M-ATX, ITX)

Align your motherboard with the case standoffs.
Now secure the motherboard with the motherboard screws.

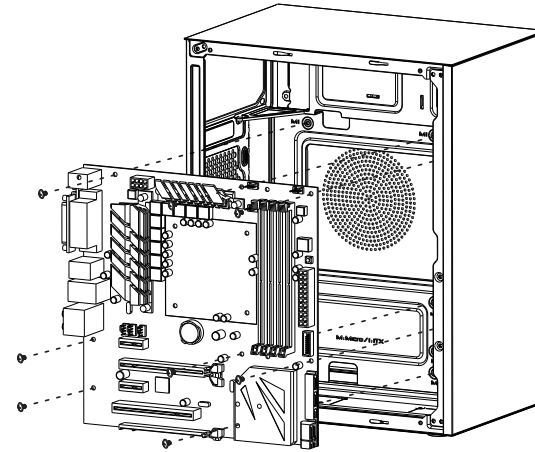


3 Power Supply Installation (supports ATX PSUs)


Position the power supply as shown in the diagram.
The fan grille must face downwards into the case.
Now secure the power supply with four screws (a).

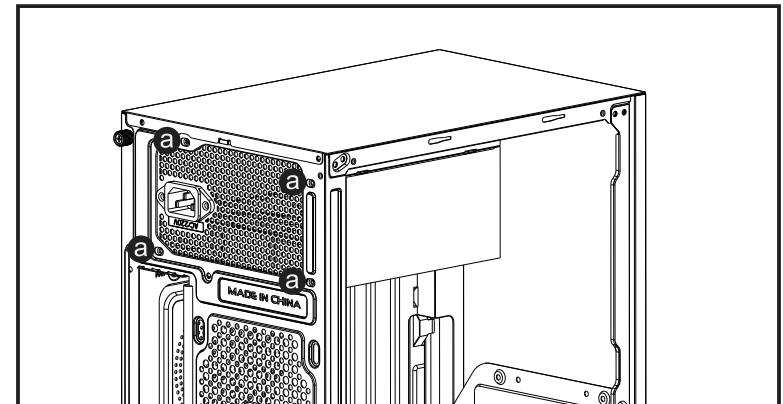

4 Graphics Card Installation

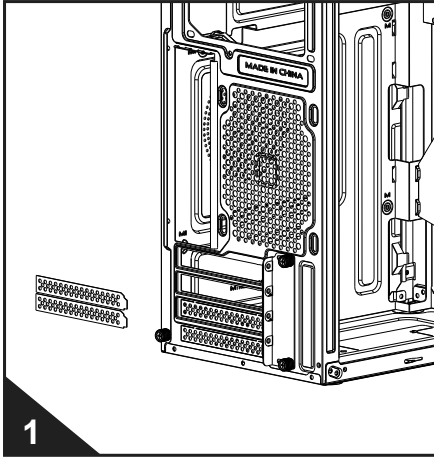


Remove the appropriate PCI slots, according to your motherboard's PCI slot configuration.

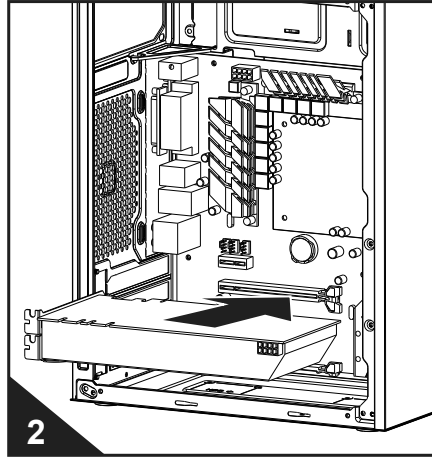


Insert the graphics card accordingly and secure it with screws.

5 HDD/SSD Installation

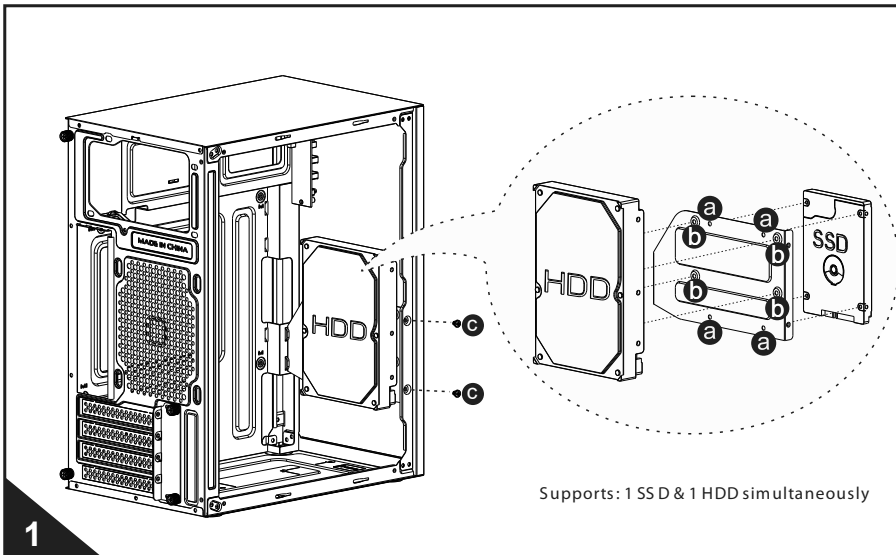


Supports: 1 SSD & 1 HDD simultaneously


- 1) Remove the HDD rack at the front of the case.
- 2) Install a 2.5" SSD and secure it with four screws (a).
- 3) Install a 3.5" HDD and secure it with four screws (b).
- 4) Now screw the HDD rack back onto the front panel (c).

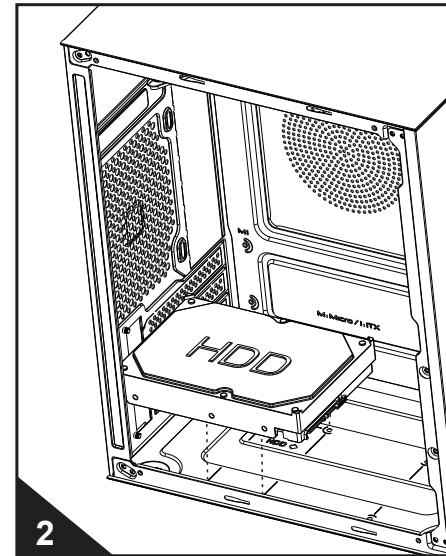

Install a 3.5" HDD on the bottom and secure it with four screws.

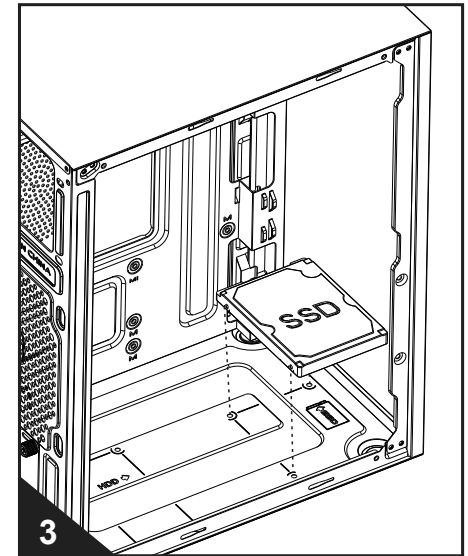

Install a 2.5" SSD on the bottom and secure it with three screws.

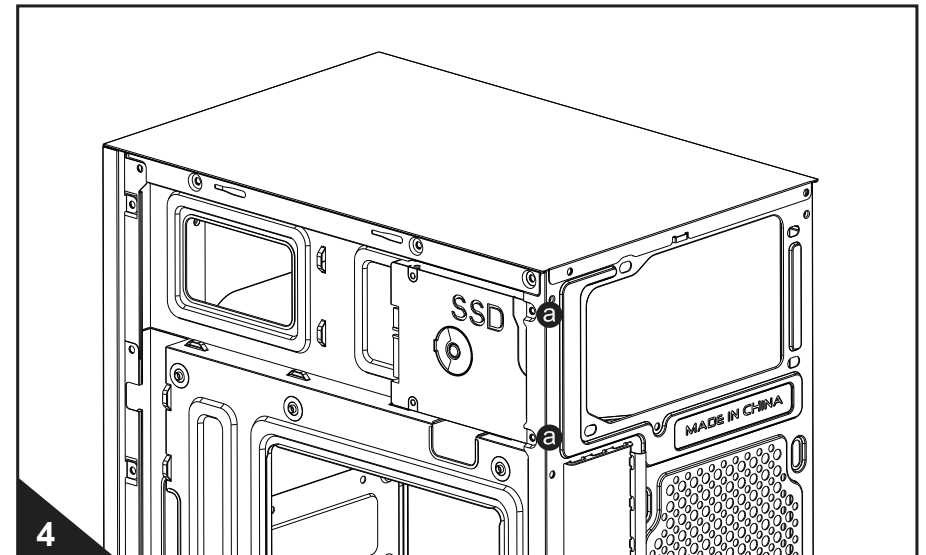

Install a 2.5" SSD on the side and secure it with two screws (a).

6 Fan Installation

A 120mm fan can be attached to the back of the case using four screws.