
Bigme

—JUST FOR YOU—


HiBreak

Quick Guide

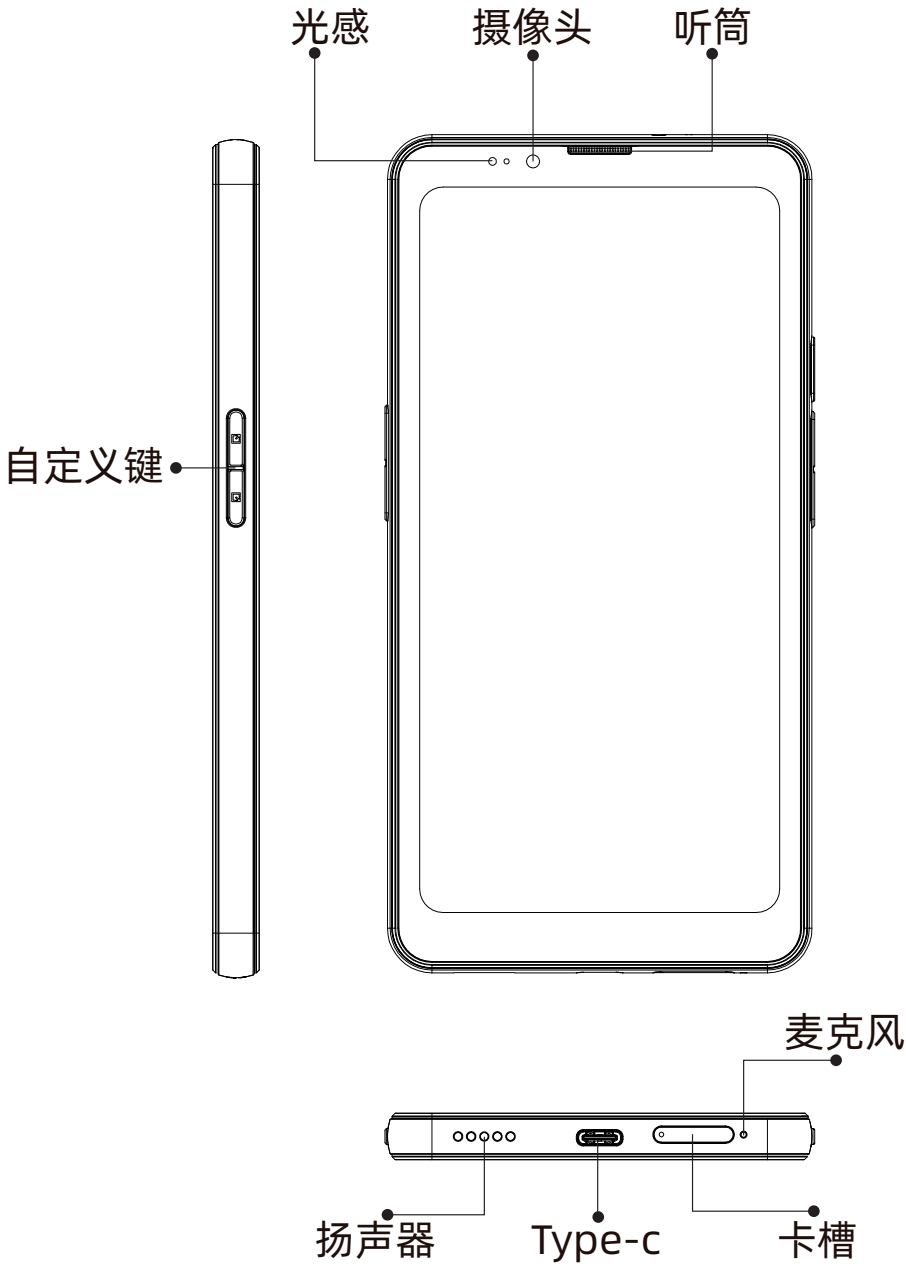

手机新品交流群

扫码添加客服微信

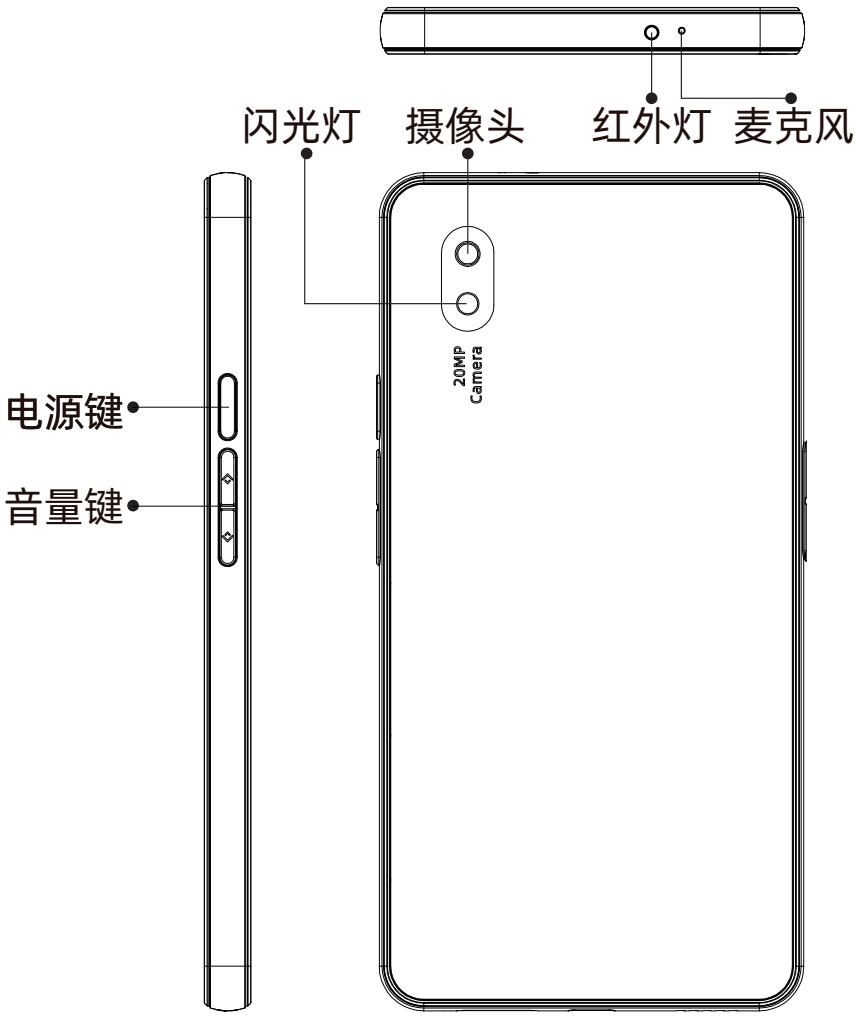

部件名称	有毒有害物质或元素					
	铅（Pb）	汞（Hg）	镉（Cd）	六价铬（Cr6+）	多溴联苯（PBB）	多溴二苯醚（PBDE）
壳体	○	○	○	○	○	○
PCB/PCBA电路模块	×	○	○	○	○	○
非金属/五金	○	○	○	○	○	○
电池	×	○	○	○	○	○
天线	○	○	○	○	○	○
标签	○	○	○	○	○	○
其他部件	○	○	○	○	○	○

本表根据SJ/T11364的规定编制。

○ 表示该物质在该部件所有均质材料中的含量均在GB/T□26572规定的限量要求以下。

× 表示该有害物质至少在该部件的某一均质材料中的含量超出GB/T□26572规定的限量要求。

1.如何开关机

1.1关机状态下，长按5秒电源开关键,即可启动设备；

1.2长按1秒电源键,弹出关机对话框,选择关机或者重启；

1.3设备支持自动休眠，可自行设置进入休眠时间;短按电源开关键，可实现休眠/唤醒切换；

1.4异常状态下,长按电源键12秒可强制复位重启。

2.如何充电

2.1请使用具备CCC认证资质的5V-2A电源适配器接交流插座通过数据线连接进行充电；

2.2通过标配数据线连接设备和电脑USB口进行充电；

2.3充电过程中开关按键白光指示灯常亮，充满电后指示灯灭；

2.4充电时间大约2小时充满。

3.如何传输数据

3.1通过USB数据线连接设备和电脑进行传输；

3.2通过大我语记同步传输。

4.注意:

4.1用错误型号电池更换会有爆炸危险，务必按照说明处置用完的电池；

4.2本产品不带电源适配器销售,消费者若适用电源适配器供电，则应购买配套使用获得CCC认证并满足标准要求的电源适配器；

用户存根联

购机信息

用户姓名:_____

联系电话:_____

详细地址:_____

购机日期:_____

发票号码:_____

售机单位名称:_____

售机单位地址:_____

售机单位电话:_____

购机信息

产品型号:_____

序列号(SN):_____

主机MEID/IMEI号码:_____

进网标志号码:_____

Bigme

—JUST FOR YOU—

合格证

QUALIFIED CERTIFICATE

型号:
(MODEL)_____

检验员:
(CHECKER)_____


出厂日期:
(DATE)_____

Bigme

—JUST FOR YOU—


HiBreak

Quick Guide

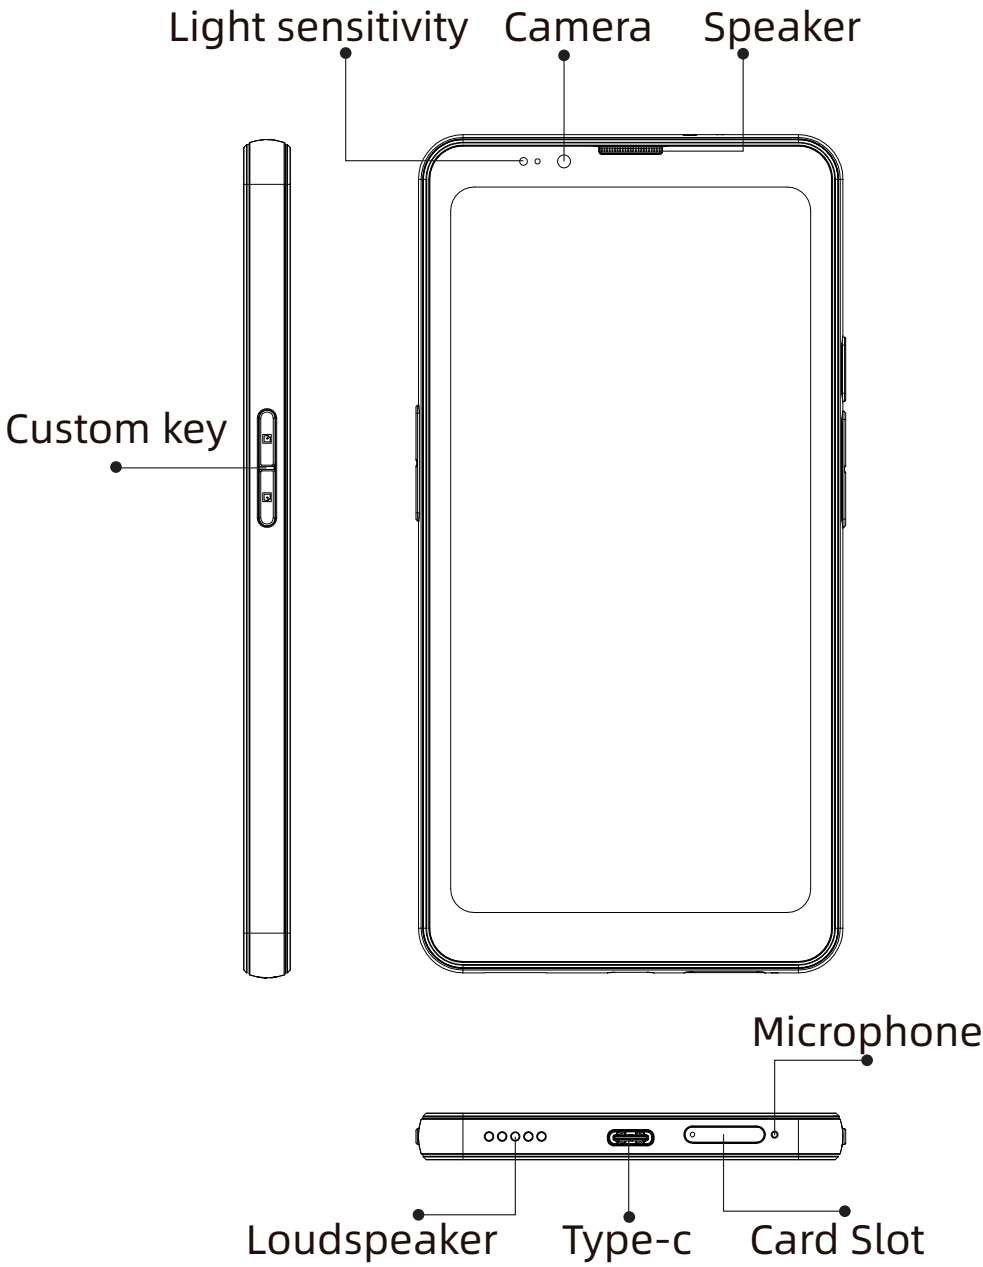

HiBreak Pro
WeChat Group

Scan the QR Code to
Add the WeChat of
Customer Service

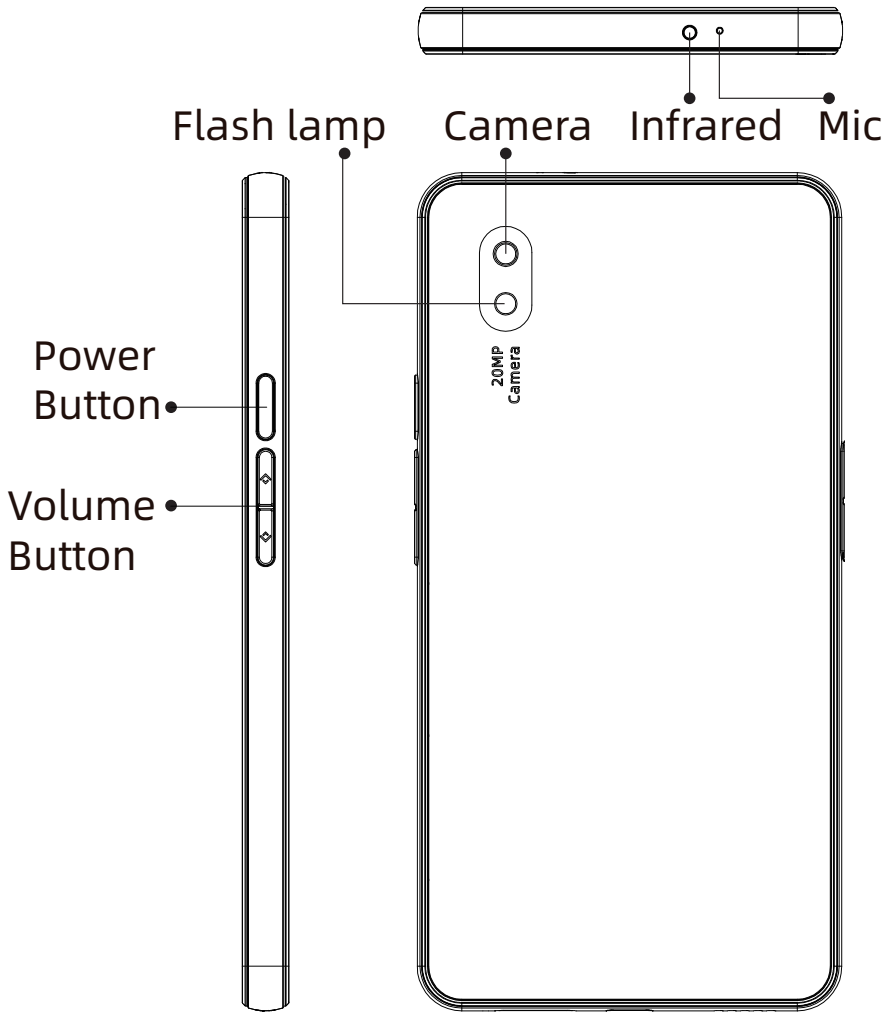

Component name	Toxic and hazardous substances or elements					
	Lead (Pb)	Mercury (Hg)	Cadmium (Cd)	Hexavalent Chromium (Cr6+)	Polybrominated Biphenyls (PBB)	Polybrominated Diphenyl Ethers (PBDE)
Shell	○	○	○	○	○	○
PCB/PCBA circuit module	×	○	○	○	○	○
Non-metal Hardware	○	○	○	○	○	○
Battery	×	○	○	○	○	○
Antenna	○	○	○	○	○	○
Label	○	○	○	○	○	○
Other components	○	○	○	○	○	○

This table is prepared according to the provisions of SJ/T11364

○ **It indicates that the content of this substance in all homogeneous materials of this component is below the limit requirements specified by GB/T26572.**

× **It indicates that the content of this harmful substance in at least one homogeneous material of this component exceeds the limit requirements specified by GB/T26572.**

1. How to turn on/off the device

1.1 In the off state, long press the power button for 5 seconds to start the device.

1.2 Long press the power button for 1 second to bring up the shutdown option,and choose to shutdown or reboot.

1.3 The device supports automatic sleep, and you can set the time to enter sleep mode yourself; short press the power button to switch between sleep/wake up.

1.4In abnormal state, press and hold the power button for 12 seconds to force reset and reboot.

2. How to Charge

2.1 Please use a 5V-2A power adapter with CCC certification to connect to the AC socket for charging via a data cable;

2.2 Charge by connecting the device and the computer's USB port with the standard data cable.

2.3 During the charging process, the white light indicator of the switch button stays on, and the indicator light goes out after the battery is full.

2.4 The charging time is about 2 hours to fully.

3. How to Transfer Data

3.1 Transfer data by connecting the device and the computer with a USB data cable.

3.2 Transfer data synchronously through Bigme Cloud.

4.Note

4.1 There is a risk of explosion when replacing with the wrong model battery, please dispose ofthe used battery according to the instructions.

4.2 This product does not come with a power adapter for sale. lf consumers use a power adapter for power supply, they should purchase a matching power adapter that has obtained CCC certification and meets the standard requirements.

User Stub

Purchase Information

User Name:_____

Contact Number:_____

Detailed Address:_____

Purchase Date:_____

Invoice Number:_____

Seller Name:_____

Seller Address:_____

Seller Phone Number:_____

Purchase Information

Product Model:_____

Serial Number (SN):_____

Host MEID/IMEI Number:_____

Network Access Mark Number:_____

Bigme

—JUST FOR YOU—

Qualified Certificate

Model:_____

Inspector:_____

Date of Manufacture:_____